
ASSEMBLY INSTRUCTIONS FOR OL3407, OL3408 (E) REV 3/28/05

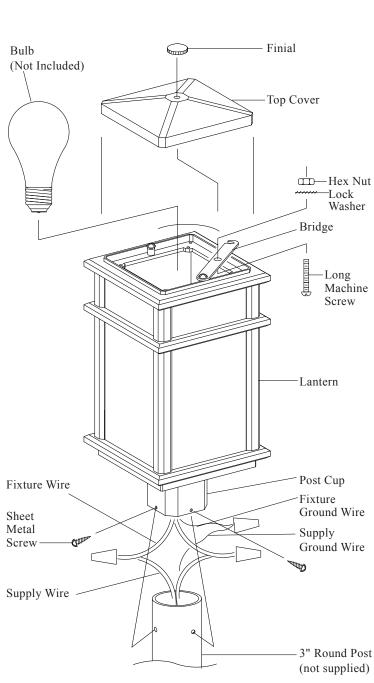

IMPORTANT TURN OFF POWER AT MAIN FUSE OR CIRCUIT **BREAKER BOX BEFORE STARTING INSTALLATION** Carefully unpack and identify all parts before beginning assembly. Bulb not included. 1. Install a long machine screw onto bridge be fastening with a lock washer and hex nut from above. 2. Swing the bridge aside. 3. Install light bulb (not included). See relamping label at socket area for type and maximum allowed wattage. 4. Swing back the bridge until it hooks onto screw. 5. Install top cover onto lantern by fastening with finial. 6. Electrical installation onto post: If you are replacing and existing fixture, disconnect and remove the old fixture. A) Slip post cup over post. Mark position of holes in post cup on post. B) Remove post cup and expose the supply wiring from above post. Drill 1/8" (3mm) diameter pilot holes in post at places where marked. C) Make wire connections. (wire connectors not provided). Refer to chart below for correct connections. Wire supply wires to fixture wires accordingly. Connect Black Fixture Wire to: Connect White Fixture Wire to: Black Supply Wire or White Supply Wire or *Parallel cord *Parallel cord (round & smooth) (square & ridged) Clear, Brown, Gold or Black Clear, Brown, Gold or Black without tracer with tracer Insulated wire Insulated wire (other than green) (other than green) with silver conductor with copper conductor *Note: When parallel wire (SPT 1 & SPT2) is used. One wire is square shaped or ridged and the other wire will be round in shape or smooth. (See Illustration) Tracer Wire

- D) Connect ground wire from supply source to fixture ground wire with connector. Never connect ground wire to black or white power supply wires. Carefully place wires inside post.
- E) Slip post cup onto post. Align holes in post cup with holes in post. Attach post cup to post with sheet metal screws.

©MURRAY FEISS IMPORT LLC.

NA I

А

R